

# FASTERCNC CO., LTD.

FASTERCNC CO., LTD.

High quality, reliable ——SKTFTV1



**SKTFTV1** Mach3 hand control box with  
screen

Product Manual (English)

[www.nvcnc.net](http://www.nvcnc.net)

# SKTFTV1 hand control box

## ▶ 1、 Introduction

SKTFTV1 is a hand control box only for usbmach3 CARD. E.g. DDSM3,DDUM6V5.0and DDMDT card.This card connect with usbmach3 CARD by USART port.It's only need 4 wires,there are RXD/TXD/+5V/GND. Most operation of software mach3 is set to this box.It's convenient to control the machine by this box.

## ▶ 2、 Specification


- High performance, low price
- Most function of mach3 is set to this box
- Supply voltage 5VDC
- XYZABC 6 axes' coordinate display on the screen.
- FRO/SRO/SJR this 3 parameter display on the creen and can be modified.
- The function of move XYZABC by hand is set to the keyboard.
- Senior function,e.g. HOME,GOTO ZERO, ZERO is set to the keyboard.
- Also base function,e.g.START,PAUSE,STOP,RESET is set to the keyboard.
- The material of this box is aluminium,and it's oxidized to deep blue.
- The panel of this box is acrylic, and it's transparent.

▶ 3、 application fields



Figure 1

▶ 4、Connect with DDSM

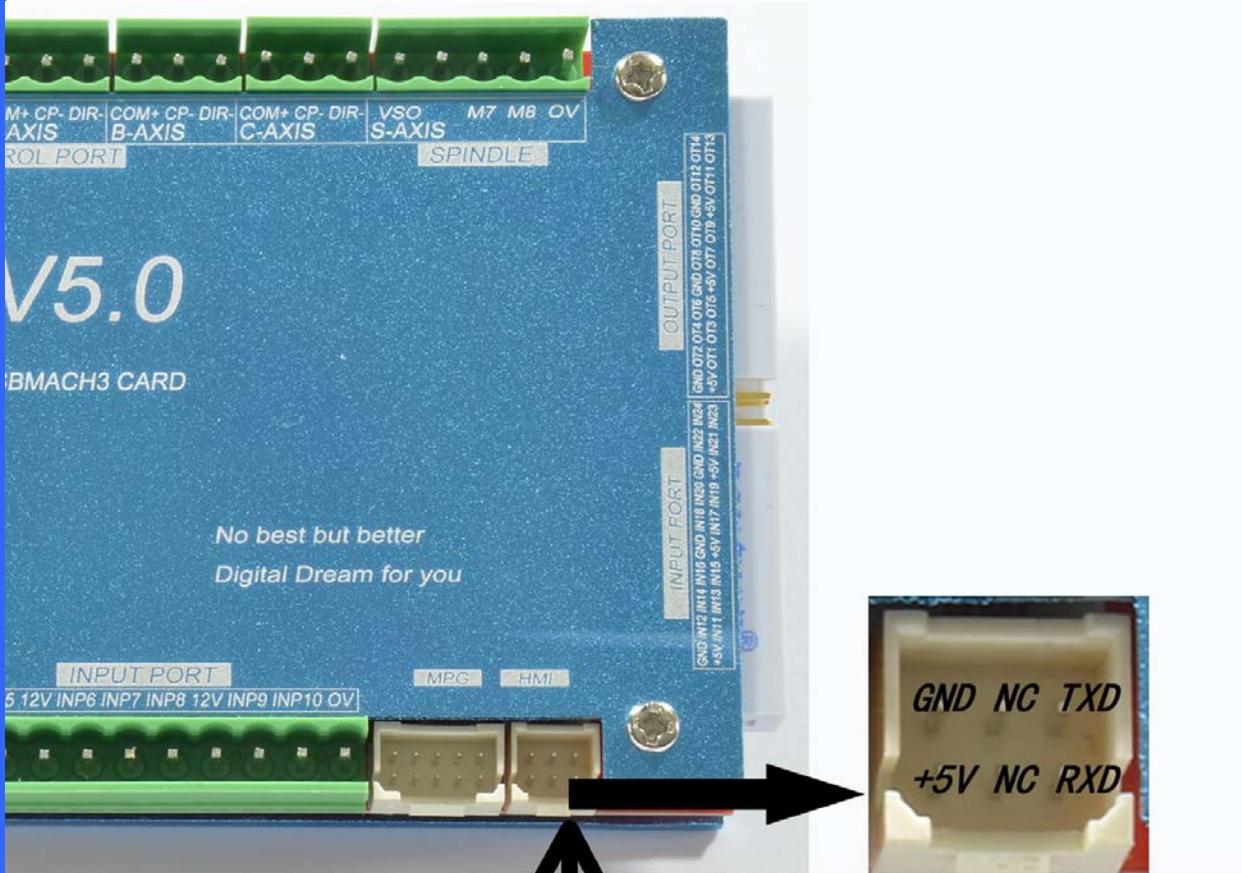

## ▶ 4、 Operation description

Control Panel define:

<b>START</b>	<b>F.HOLD</b>	<b>REWIND</b>	<b>RESET</b>
Z/C ↑	Y/B ↑	CON/STEP	+
X/A ←	XYZ/ ABC	X/A →	-
Z/C ↓	Y/B ↓	<b>F/S</b>	<b>SJR</b> <b>SRO FRO</b>
<b>HOME</b>	<b>GOTO Z</b>	<b>ZERO</b>	<b>SPINDLE</b>

Figure 2 definition of keyboard

Description of keyboard

KEY	POSITION	function
<b>START</b>	R1C1	Same with Cycle Start<Alt-R> in software mach3 ,push this

		key then the G-code will run
<b>F.HOLD</b>	R1C2	Same with Feed Hold<spc>in software mach3,push this key then the runing G-code will be hold on.
<b>REWIND</b>	R1C3	Same with Rewind Ctrl-W in software mach3,push this key then the G-code run line will be set to line 1.
<b>RESET</b>	R1C4	Same with Reset in software mach3,push this key then the system will be RESET.
<b>Z/C ↑</b>	R2C1	When select XYZ status,push this key then the Z axis will move forward with G1 speed.when select ABC status, push this key then the C axis will move forward with G1 speed.
<b>Y/B ↑</b>	R2C2	When select XYZ status,push this key then the Y axis will move forward with G1 speed.when select ABC status, push this key then the B axis will move forward with G1 speed.
<b>CON/STEP</b>	R2C3	Change continuous mod or step mod for each axis
<b>+</b>	R2C4	Increase parameter FRO/SRO/SJR
<b>X/A ←</b>	R3C1	When select XYZ status,push this key then the X axis will move forward with G1 speed.when select ABC status, push this key then the A axis will move forward with G1 speed.
<b>XYZ/ABC</b>	R3C2	Switch XYZ mod or ABC mod
<b>X/A →</b>	R3C3	When select XYZ status,push this key then the X axis will move opposite with G1 speed.when select ABC status, push this key then the A axis will move opposite with G1 speed.
<b>-</b>	R3C4	Decrease parameter FRO/SRO/SJR

<b>Z/C ↓</b>	R4C1	When select XYZ status,push this key then the Z axis will move opposite with G1 speed.when select ABC status, push this key then the C axis will move opposite with G1 speed.
<b>Y/B ↓</b>	R4C2	When select XYZ status,push this key then the Z axis will move opposite with G1 speed.when select ABC status, push this key then the C axis will move opposite with G1 speed.
<b>F/S</b>	R4C3	Switch Fast mod or Slow mod. In fast mod,SJR is set by user, in slow mod,SJR is fixed to 10%
<b>SJR SRO FRO</b>	R4C4	Switch Current parameter,this key is used with '+' and '-'
<b>HOME</b>	R5C1	This key's function is the same as home key in mach3.It will make machine to find machine zero point.
<b>GOTO Z</b>	R5C2	To goto zero point in current coordinate system.
<b>ZERO</b>	R5C3	To make current coordinate to zero
<b>SPINDLE</b>	R5C4	This key is the same with the key Spindle CW F5 in mach3.Turn on/off the spindle.

## ▶ 5、 Common operation

1、 Move X axis to left in continuous mod

- push the key "CONT/STEP" to make the block under C/S in the screen to yellow.
- push the key "XYZ/ABC" to make the screen in XYZ mod. see as figure 2
- push the key "X/A ←".

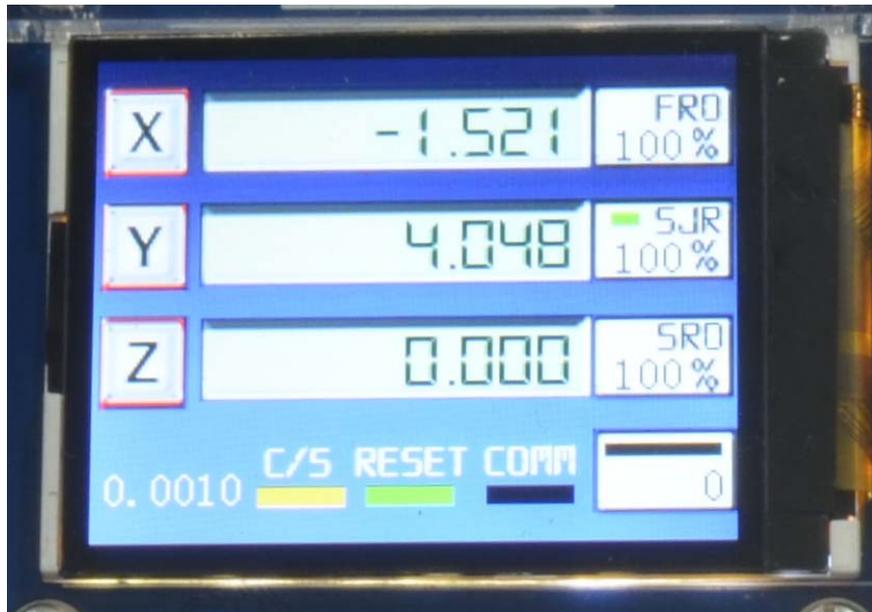


figure 2

## 2、 Move X axis to left in step mod

- push the key "CONT/STEP" to make the block under C/S in the screen to black.
- push the key "XYZ/ABC" to make the screen in XYZ mod. see as figure 3
- push the key "X/A ←".

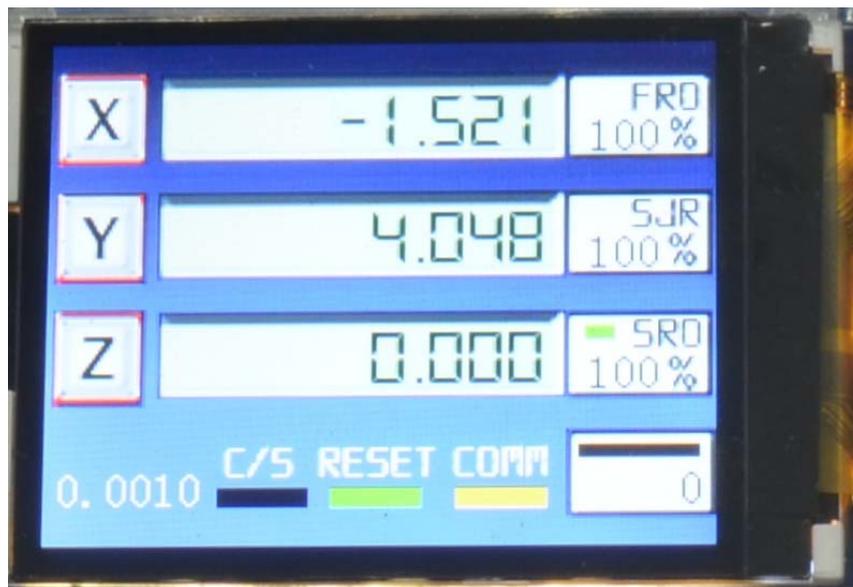


figure 3

## 3、 Zero X axis current coordinate

- push the key "RESET" to make the block under RESET in the screen to green.
- push the key "ZERO", then the block under COMM in the screen will change to yellow.
- push the key "X→".....this function of Y Z A B C axis is to push the key "X/A →" and the key "Y/B ↑" and the key "Z/C ↓".

see as figure 3

## 4、 Zero all axes current coordinate

- push the key "RESET" to make the block under RESET in the screen to green.
- push the key "ZERO", then the block under COMM in the screen will change to yellow.
- push the key "ZERO" again. then all axes' current coordinate will change to zero.

see as figure 3

5、 Make X axis to goto zero.

- push the key "RESET" to make the block under RESET in the screen to green.
- push the key "GOTOZ", then the block under COMM in the screen will change to yellow.
- push the key "X→".....this function of Y Z A B C axis is to push the key "X/A →" and the key "Y/B ↑" and the key "Z/C ↓".

6、 Make all axes to goto zero

- push the key "RESET" to make the block under RESET in the screen to green.
- push the key "GOTOZ", then the block under COMM in the screen will change to yellow.
- push the key "GOTOZ" again. then all axes' current coordinate will change to zero.

7、 Change the parameter FRO

- push the key "SJR/SRO/FRO" to put the green block beside FRO in the screen.see as figure 4



figure 4

- push the key "+" to increase FRO or push the key "-" to decrease FRO

8、 Change the parameter SRO

- push the key "SJR/SRO/FRO" to put the green block beside SRO in the screen.see as figure 5

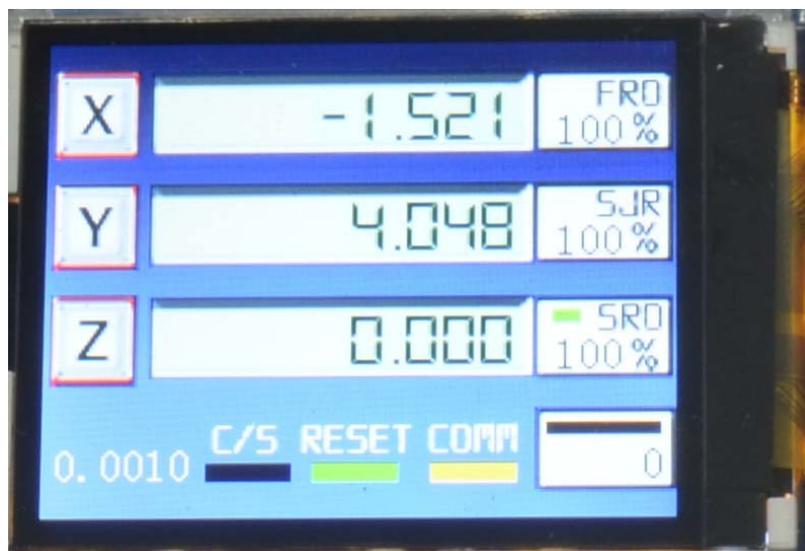


figure 5

- push the key "+" to increase SRO or push the key "-" to decrease SRO

9、 Change the parameter SJR

- push the key "SJR/SRO/FRO" to put the green block beside SJR in the screen.see as figure 6



figure 6

- push the key "+" to increase SJR or push the key "-" to decrease SJR

9、 Change the parameter step distance

- push the key "SJR/SRO/FRO" to put the green block beside SJR in the screen.
- push the key "CON/STEP" to make the block under C/S to black. see as figure 7
- push the key "+" or "-" will change step distance to 1.0 or 0.1 or 0.01 or 0.001 or 0.0001.

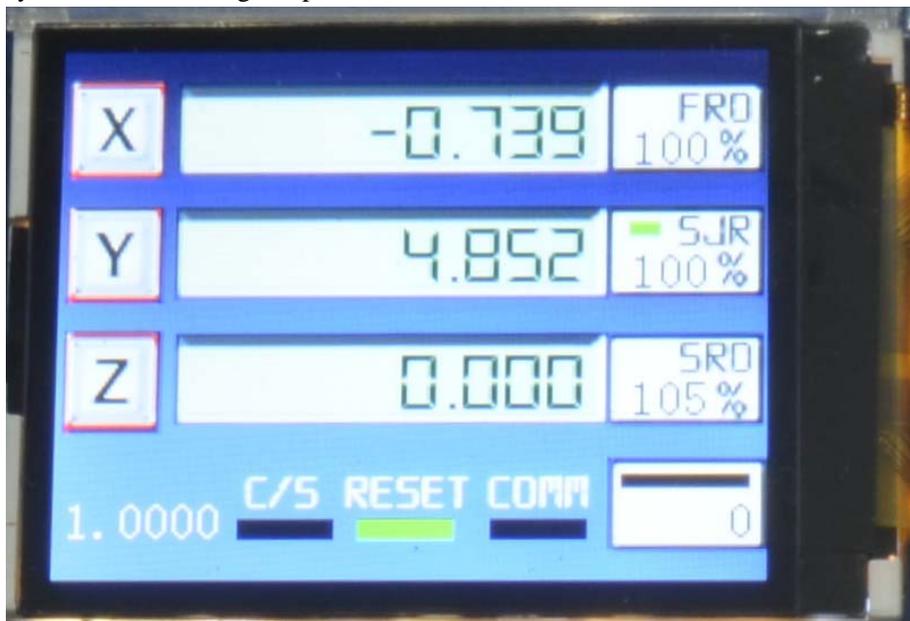


figure 7